Product Data Sheet

Product Datasheet

3HYE Hydrogen Sensor

Document Purpose

The purpose of this document is to present the performance specification of the 3HYE Hydrogen gas sensor.

This document should be used in conjunction with the Operating Principles (OP08) and the Product Safety Datasheet (PSDS 5).

The data provided in this document are valid at 20°C, 50% RH and 1013 mBar for 3 months from the date of sensor manufacture.

Output signal can drift below the lower limit over time. For guidance on the safe use of the sensor, please refer to the Operating Principles OP08.

Doc. Ref.: 3HYE.indd ECN I 4849 Issue 6

12th June 2017



Product Data Sheet

Key Features & Benefits:

- Robust, 3-Series packaging
- Range of accessories available

Technical Specifications

MEASUREMENT

Operating Principle | 3-electrode electrochemical

Measurement Range 0-10,000 ppm H₂
Maximum Overload 20,000 ppm H₂

Filter | None

Sensitivity* 3 ± 1 nA/ppm

Resolution 10 ppm

Response Time (T₉₀)* <70 seconds

Baseline Offset (clean air) +2 to -150 ppm equivalent

Zero Shift (+20°C to +40°C) -150 ppm equivalent

Repeatability 2% of signal Linearity Linear

ELECTRICAL

Recommended Load Resistor 10 Ω

Bias Voltage | Not Required

MECHANICAL

Weight | 22 g Orientation | Any


ENVIRONMENTAL


Operating Temperature Range | -20°C to +50°C Recommended Storage Temp | 0°C to 20°C | 00°C to 20°C | 00°C to 20°C

Operating Pressure Range | Atmospheric ± 10% | Pressure Coefficient | 0.006 % signal / mbar

Operating Humidity Range | 15 - 90% RH non-condensing

Product Dimensions

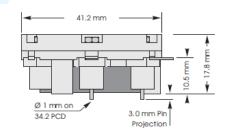

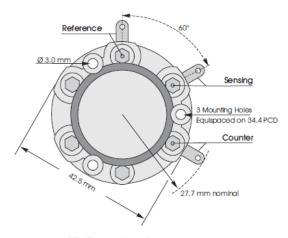

All dimensions in mm
All tolerances ±0.15 mm unless otherwise stated
3HYE shown with side tags and gold pins

PART NUMBER FOR ORDERING

Sensor	Description	Part Number
3HYE	With side tag and PCB pin connections	AE006-J30

LIFETIME

Long Term Sensitivity Drift* | <2% signal loss/month
Expected Operating Life | Two years in air
Storage Life | 6 months in original container

IMPORTANT NOTE:

Soldering to the pin connections will seriously damage the sensor and invalidate the warranty.

* Specifications are valid at 20°C, 50% RH and 1013 mBar, using recommended circuitry. Performance characteristics outline the performance of sensors supplied within the first 3 months. Output signal can drift below the lower limit over time.

Doc. Ref.: 3HYE.indd ECN I 4849 Issue 6

12th June 2017

Page 2 of 3

Product Data Sheet

Poisoning

Sensors are designed for operation in a wide range of environments and harsh conditions. However, it is important that exposure to high concentrations of solvent vapours is avoided, both during storage, fitting into instruments and operation.

When using sensors with printed circuit boards (PCBs), degreasing agents should be used before the sensor is fitted. Do not glue directly on or near the sensor as the solvent may cause crazing of the plastic.

Cross Sensitivity Table

Whilst sensors are designed to be highly specific to the gas they are intended to measure, they will still respond to some degree to various other gases. The table below is not exclusive and other gases not included in the table may still cause a sensor to react.

IMPORTANT NOTE: The cross sensitivity data shown below does not form part of the product specification and is supplied for guidance only. Values quoted are based on tests conducted on a small number of sensors and any batch may show significant variation. For the most accurate measurements, an instrument should be calibrated using the gas under investigation.

Gas	Concentration Used	3HYE (ppm H ₂)
Carbon Monoxide, CO	300	< 120
Hydrogen Sulfide, H ₂ S	15	10
Sulfur Dioxide, SO ₂	5	0
Nitric Oxide, NO	35	< 10
Nitrogen Dioxide, NO ₂	5	0
Chlorine, Cl ₂	1	0
Hydrogen Cyanide, HCN	10	10
Hydrogen Chloride, HCl	5	0
Ethylene, C ₂ H ₄	100	40

SAFETY NOTE

This sensor is designed to be used in safety critical applications. To ensure that the sensor and/or instrument in which it is used, are operating properly, it is a requirement that the function of the device is confirmed by exposure to target gas (bump check) before each use of the sensor and/or instrument. Failure to carry out such tests may jeopardise the safety of people and property.

Every effort has been made to ensure the accuracy of this document at the time of printing. In accordance with the company's policy of continued product improvement, the manufacturer reserves the right to make product changes without notice. The products are always subject to a programme of improvement and testing which may result in some changes in the characteristics quoted. As the products may be used by the client in circumstances beyond the knowledge and control of the manufacturer, we cannot give any warranty as to the relevance of these particulars to an application. It is the clients' responsibility to carry out the necessary tests to determine the usefulness of the products and to ensure their safety of operation in a particular application.

Doc. Ref.: 3HYE.indd ECN I 4849 Issue 6

12th June 2017

